



SERVICE BULLETIN # 00232

201 INDUSTRIAL BOULEVARD • KEARNEYSVILLE, WV 25430

Phone: (304) 728-7056 • Fax: (304) 725-6579 • Toll Free: (800) 931-9214

PAGE: 1 of 2

DATE: 4-30-02

REVISION: 00

SUBJECT: Installation of a Plastic Anti-Bridging Baffle

of People
Required



MODELS: MIV, Milk Merchandiser

Part Number	Part Description
257142	Front Column 72" Plastic Anti-Bridging Kit
256142	Front Column 79" Plastic Anti-Bridging Kit
256143	Rear Column Plastic Anti-Bridging Kit

TOOLS REQUIRED: Utility Knife

ESTIMATED INSTALLATION TIME: 5 minutes

REASON FOR BULLETIN: To reduce the problems associated with product "bridging."

INSTALLATION INSTRUCTIONS:

Remove power from vender by unplugging vender's main power cord from the AC voltage power source.


FRONT COLUMNS

1. Unload column to be retrofitted.
2. Remove product retainers from column, if present.
3. Using a utility knife carefully cut out the corresponding holes through the anti-bridging sheet to insert the plastic baffle hooks and locking tabs or remove anti-bridging sheets.
4. Insert hooks of the plastic baffle into the corresponding rectangular slots in the metal baffle (see figure B). Then for the MIV Vender, snap locking tabs from the plastic baffle into slot 5 in the top row and slot 11 of the bottom row. For the Milk Vender, snap locking tabs into slot 4 in the top row and slot 10 of the bottom row. Refer to figure A
5. Use product retainer from the kit and set to desired product setting.

REAR COLUMNS

1. Unload column to be retrofitted.
2. Remove product retainers from column, if present.
3. Using a utility knife carefully cut out the corresponding rectangular slots in the metal baffle through the anti-bridging sheet to insert the plastic baffle hooks and locking tabs or remove anti-bridging sheets.
4. Insert hooks of the plastic baffle into the corresponding holes (see figure B). Then for the MIV Vender, snap locking tabs from the plastic baffle into slot 4 in the top row and slot 10 of the bottom row. For the Milk Vender, snap locking tabs into slot 3 in the top row and slot 9 of the bottom row. Refer to figure A

Figure A

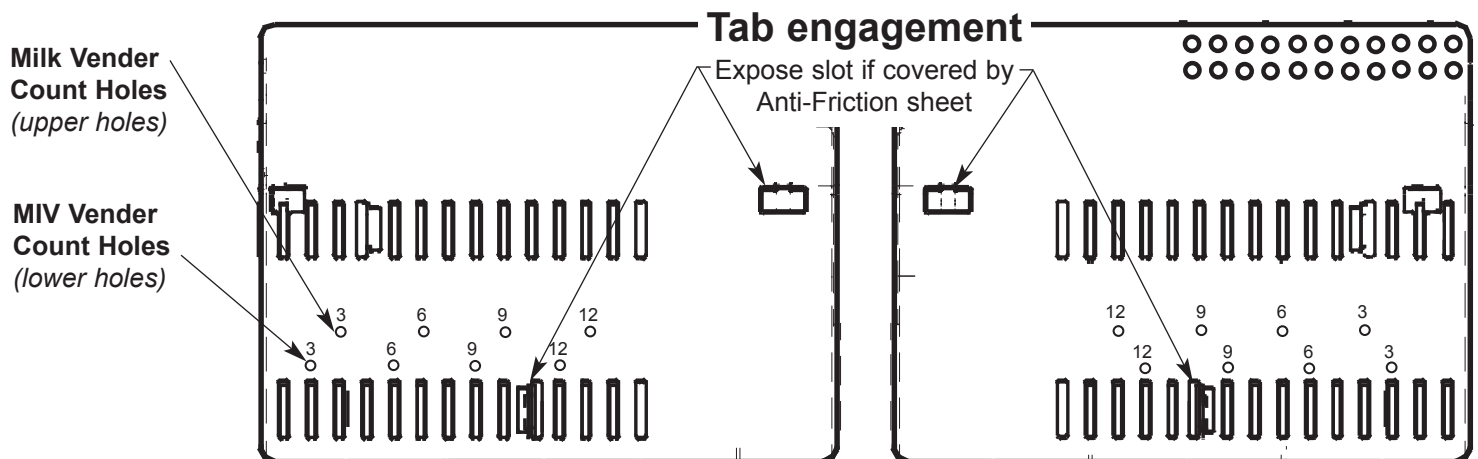

ANY QUESTIONS??? CONTACT ROYAL VENDORS' CUSTOMER SERVICE DEPARTMENT
CALL TOLL FREE (800) 931-9214



SERVICE BULLETIN # 00232

201 INDUSTRIAL BOULEVARD • KEARNEYSVILLE, WV 25430

Phone: (304) 728-7056 • Fax: (304) 725-6579 • Toll Free: (800) 931-9214

PAGE: 2 of 2


DATE: 4-30-02

REVISION: 00

SUBJECT: Installation of a Plastic Anti-Bridging Baffle

MODELS: MIV, Milk Merchandiser

Figure B

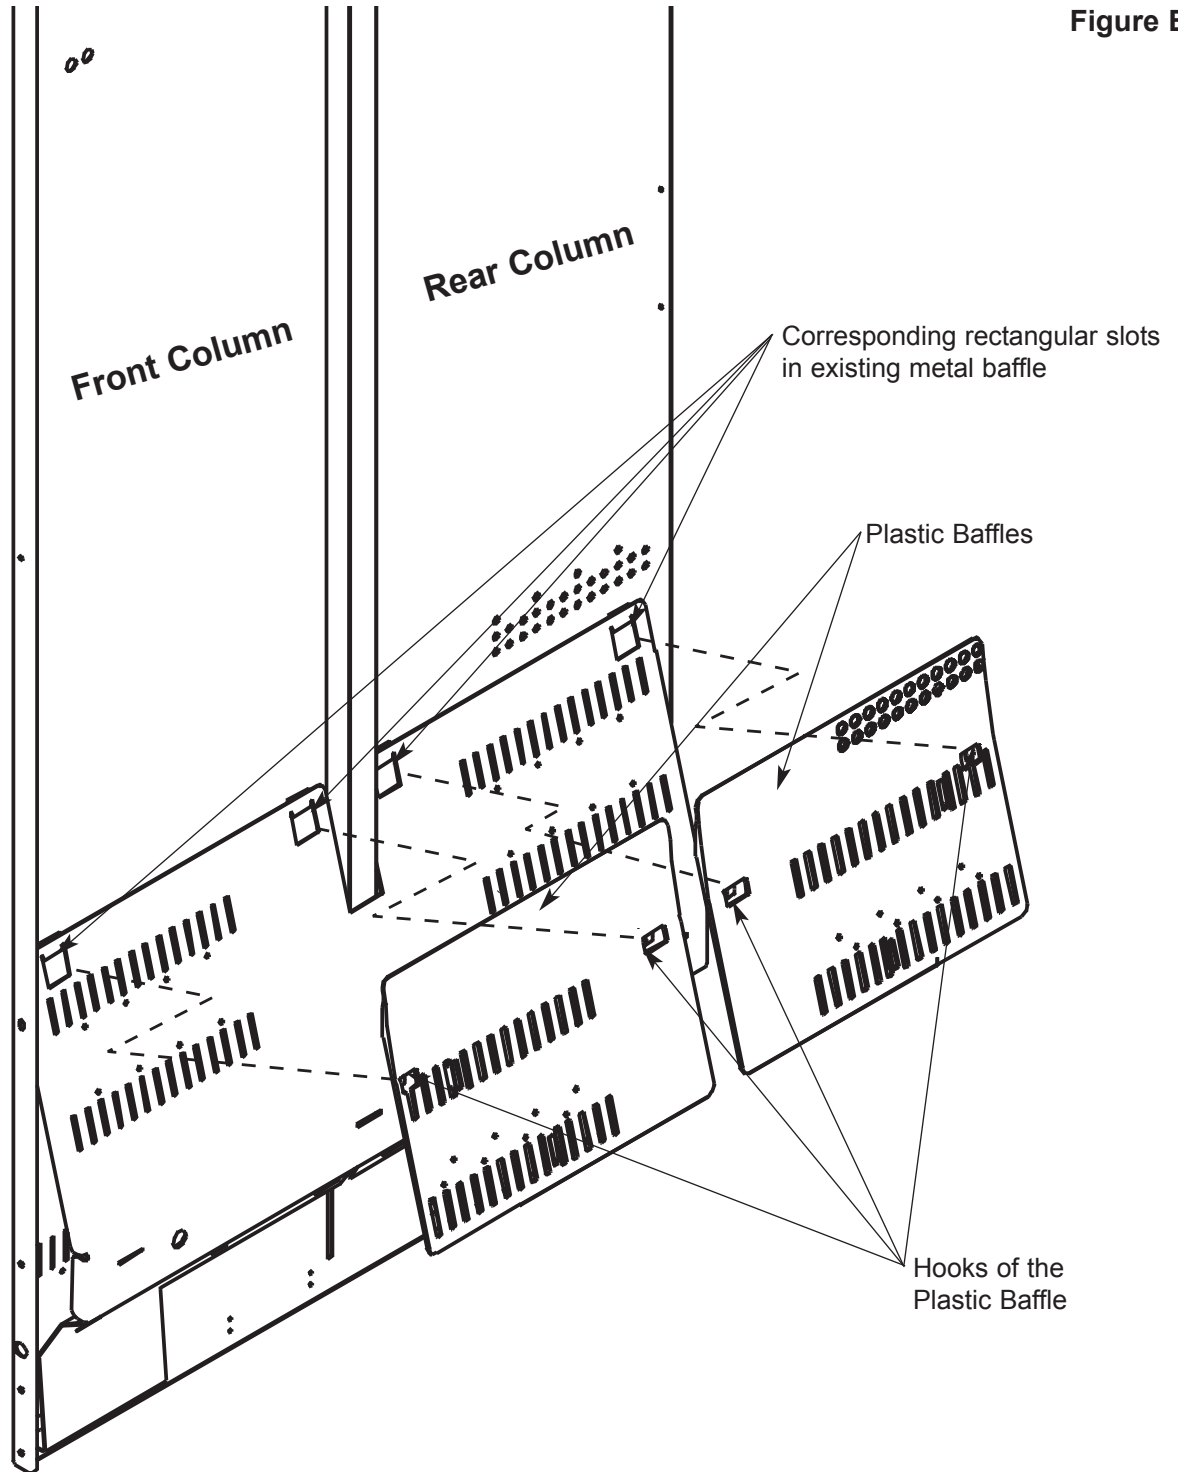

**ANY QUESTIONS??? CONTACT ROYAL VENDORS' CUSTOMER SERVICE DEPARTMENT
CALL TOLL FREE (800) 931-9214**